

**Erledigt**

## **High Sierra error verifying firmware**

**Beitrag von „al6042“ vom 30. September 2017, 11:48**

For High Sierra you should use either a current Clover-Version beginning with 4173, better 4220.

Also use the newest Clover Configurator 4.52.0.0 in which you can create the newest SMBIOS combinations, which also contain values for "Firmware Features", "Firmware Feature Mask" and the newest "BIOS Version"-numbers and "Bios Release Dates".

Those values can also be added to a defaults.plist file for your Ozmosis-based System.

This file should be placed on the hidden EFI-partition under /EFI/Oz.

Any changes made in there must be activated by doing an NVRAM-Reset, by using the following keyboard shortcuts while in BIOS, Boot menu or in Ozmosis menu:

Alt+WinLogo+P+R

All the folks still forget to create their own defaults.plist instead of using the one within the Ozmosis-ROM.

With all the different possible hardware setups and combinations, the usage of a dedicated defaults.plist is mandatory.