

Mac OS Monterey - Probleme nach der Aktualisierung

Beitrag von „LetsGo“ vom 3. April 2021, 16:51

[JN25](#)

Gut möglich, dass schon ein falsches VBIOS geflasht war. Würde an deiner Stelle vielleicht mal direkt auf der Karte nachsehen, was für ein Samsung Speicher verbaut ist.

Versuchs mal, wie in dem von mir verlinkten Guide bzw. wie [Raptortosh](#) vorgeschlagen hat.

Flashing AMD cards

Download [AMD's flashing utility](#) and extract it to the some folder. Copy the BIOS file(s) to the same folder.


First try the GUI version (AMDVBFlashWin), if it doesn't work, use the command prompt version (search for cmd.exe and run it with administrator privileges).

Navigate to the folder where you put the files:

CD C:\Fullpath\

If the folder is C:\Users\David\Downloads\New folder use "CD C:\Users\David\Downloads\New folder\ "

Type: "amdvbflash -i" to see which adapter id is the bricked card.

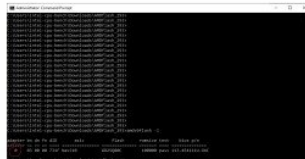

And then type:

```
amdvbflash -unlockrom 0  
amdvbflash -f -p 0 filename.rom
```

Change 0 to the correct adapter id, and filename.rom to the video BIOS file