

Bluetooth/Airplay über Fenvi FV-T919 will nicht.

Post by "Kaffebecher" of Feb 4th 2025, 11:20 am

Hm, hab jetzt mehrfach noch einmal mit dem <https://github.com/corpnewt/USBMap> Guide eine neue USB Map erstellt, Dummy USB Kext geladen, dann gemapped und alle Connector Typen gemacht, Dummy Kext ausgetauscht mit der erstellten USB Map, reboot -> Es will immer noch nicht. Wirklich komplett ratlos an dieser Stelle 😞


Wohl gemerkt, ich hab wirklich nicht einen Peil was ich hier mache. Ich folge nur blinds irgendwelchen Guides, in der Annahme dass mich das irgendwo hinbringt.

e: Grad mal in Windows 10 die Bluetooth und WLAN Treiber für die Fenvi T919 installiert, da funktioniert - das schliesst schon einmal aus dass Bluetooth gar nicht auf der Karte funktioniert.

e2: Okay got it fixed! Weil dieser BCM_4350C2 Chipsatz doch wohl was spezielleres ist, hab ich mal das <https://github.com/acidanthera/BrcmPatchRAM> BluetoothFixup Kext hinzugefügt. Jetzt geht auch Bluetooth und somit auch Airdrop.

Vielen Dank noch einmal für den Hinweis auf den Chipsatz.

hackintosh-forum.de/attachment/220909/

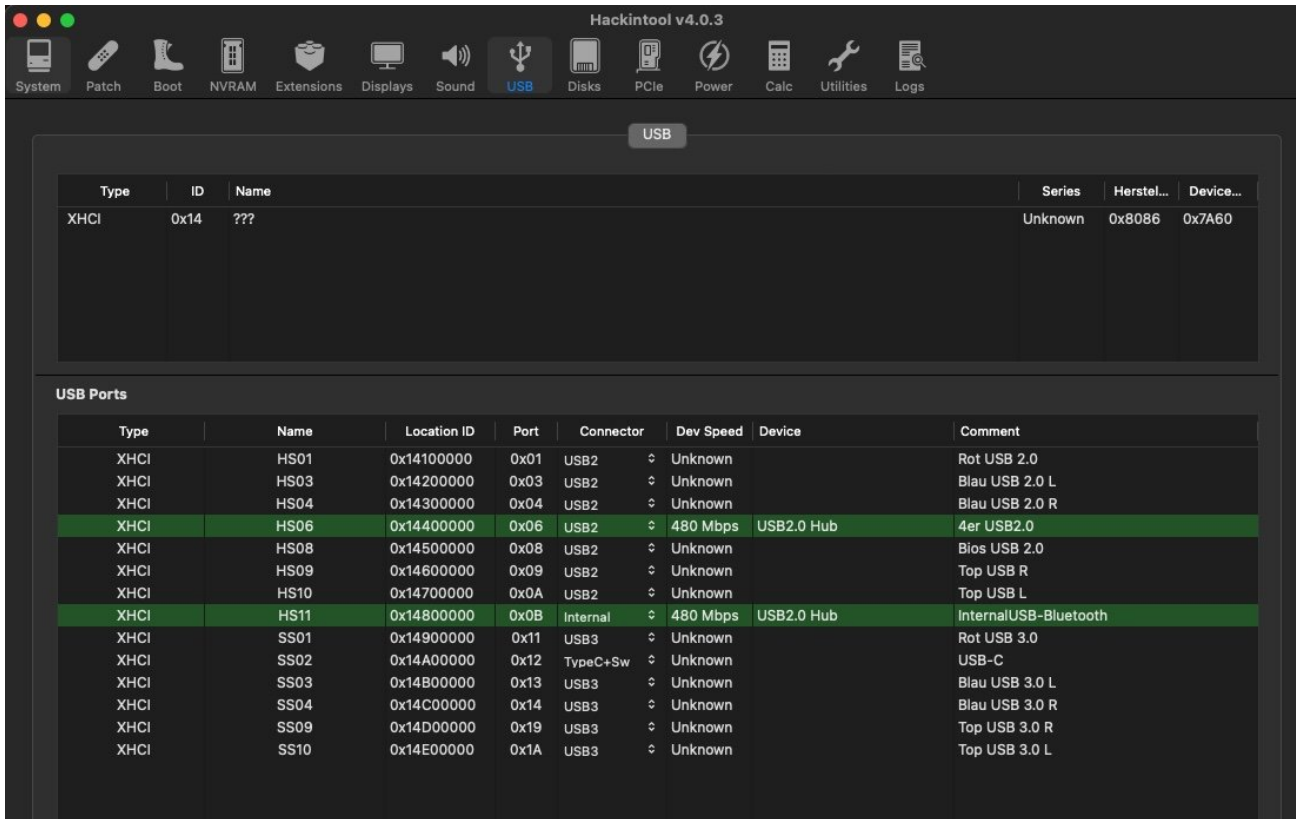

```

# Discover USB Ports #
#####

----- XHCI@14 Controller -----
1. HS01 | AppleUSB20XHCIPort | 1 (01000000) | 14100000 | Type 0
Rot USB 2.0 (from ioreg)
2. HS03 | AppleUSB20XHCIPort | 3 (03000000) | 14200000 | Type 0
Blau USB 2.0 L (from ioreg)
3. HS04 | AppleUSB20XHCIPort | 4 (04000000) | 14300000 | Type 0
Blau USB 2.0 R (from ioreg)
4. HS06 | AppleUSB20XHCIPort | 6 (06000000) | 14400000 | Type 0
4er USB2.0 (from ioreg)
- USB2.0 Hub
- AppleUSB20Hub
- MX518 Gaming Mouse
- PCR
- USB2.1 Hub
- AppleUSB20Hub
- LG Monitor Controls
- Keyboard Hub
- AppleUSB20KeyboardHub
- Apple Keyboard
- AppleUSB20Hub
- UltraLite-mk5
5. HS08 | AppleUSB20XHCIPort | 8 (08000000) | 14500000 | Type 0
Bios USB 2.0 (from ioreg)
6. HS09 | AppleUSB20XHCIPort | 9 (09000000) | 14600000 | Type 0
Top USB R (from ioreg)
7. HS10 | AppleUSB20XHCIPort | 10 (0a000000) | 14700000 | Type 0
Top USB L (from ioreg)
8. HS11 | AppleUSB20XHCIPort | 11 (0b000000) | 14800000 | Type 255
InternalUSB-Bluetooth (from ioreg)
- USB2.0 Hub
- AppleUSB20InternalHub
- BRCM20702 Hub
- AppleUSB20Hub
- Bluetooth USB Host Controller
9. SS01 | AppleUSB30XHCIPort | 17 (11000000) | 14900000 | Type 3
Rot USB 3.0 (from ioreg)
10. SS02 | AppleUSB30XHCIPort | 18 (12000000) | 14a00000 | Type 9
USB-C (from ioreg)
11. SS03 | AppleUSB30XHCIPort | 19 (13000000) | 14b00000 | Type 3
Blau USB 3.0 L (from ioreg)
12. SS04 | AppleUSB30XHCIPort | 20 (14000000) | 14c00000 | Type 3
Blau USB 3.0 R (from ioreg)
13. SS09 | AppleUSB30XHCIPort | 25 (19000000) | 14d00000 | Type 3
Top USB 3.0 R (from ioreg)
14. SS10 | AppleUSB30XHCIPort | 26 (1a000000) | 14e00000 | Type 3
Top USB 3.0 L (from ioreg)

Populated:
pci1002,73a4: 0, XHCI: 2

Press Q then [enter] to stop

```